



**Operating Instructions  
ACX-1 Series Digital  
Aircraft Cable Tension Meter**

[www.cooperinstruments.com](http://www.cooperinstruments.com)

PH: 540-349-4746 ■ FAX: 540-347-4755

# TABLE OF CONTENTS

- 1. WARRANTY POLICY ..... 4
- 2. SPECIFICATIONS ..... 5
- 3. SAFETY..... 6
- 4. INSTRUMENT OPTIONS ..... 7
  - Standard Instruments ..... 7
  - Add-On Options ..... 8
    - A Analog Output option..... 8
    - E RS-232 Serial Output option ..... 8
  - Features of all Instruments ..... 8
- 5. BASIC OPERATION..... 9
  - Charging Instrument Batteries ..... 9
  - Quick Start Instructions ..... 9
  - Engaging Instrument onto Cable..... 11
- 6. DISPLAY SCREENS ..... 12
  - SETUP Screen ..... 12
    - LCD Refresh Rate ..... 12
    - Data Averaging ..... 13
    - Custom Names ..... 13
    - Re-Cal Tension: See description at the end of this booklet. .... 13
    - Audio ..... 13
    - Backlight ..... 13
    - Set-Point Menu ..... 13
    - Version ..... 14
  - DATA LOGGING Screen ..... 14
    - View Data Stats ..... 14
    - View Data Log..... 14
    - Clear Single Point Log ..... 14
  - TENSION UNITS Screen ..... 14
  - SELECT MATERIAL Screen ..... 14

7. ADVANCED OPERATION ..... 15

General Calibration Precautions ..... 15

Check Accuracy ..... 15

Calibrate Instrument ..... 16

# 1. WARRANTY POLICY

## Limited Warranty on Products

Any Cooper Instruments product which, under normal operating conditions, proves defective in material or in workmanship within one year of the date of shipment by Cooper will be repaired or replaced free of charge provided that a return material authorization is obtained from Cooper and the defective product is sent, transportation charges prepaid, with notice of the defect, and it is established that the product has been properly installed, maintained, and operated within the limits of rated and normal usage. Replacement or repaired product will be shipped F.O.B. from our plant. The terms of this warranty do not extend to any product or part thereof which, under normal usage, has an inherently shorter useful life than one year. The replacement warranty detailed here is the buyer's exclusive remedy, and will satisfy all obligations of Cooper whether based on contract, negligence, or otherwise. Cooper is not responsible for any incidental or consequential loss or damage which might result from a failure of any and all other warranties, express or implied, including implied warranty of merchantability or fitness for particular purpose. Any unauthorized disassembly or attempt to repair voids this warranty.

## Obtaining Service under Warranty


Advance authorization is required prior to the return to Cooper Instruments. Before returning the item, contact the Repair Department c/o Cooper Instruments at (540) 349-4746 for a Return Material Authorization number. Shipment to Cooper shall be at buyer's expense and repaired or replacement items will be shipped F.O.B. from our plant in Warrenton, Virginia. Non-verified problems or defects may be subject to a \$150 evaluation charge. Please return the original calibration data with the unit.

## Repair Warranty

All repairs of Cooper products are warranted for a period of 90 days from date of shipment. This warranty applies only to those items that were found defective and repaired; it does not apply to products in which no defect was found and returned as is or merely recalibrated. It may be possible for out-of-warranty products to be returned to the exact original specifications or dimensions.

\* Technical description of the defect: In order to properly repair a product, it is absolutely necessary for Cooper to receive information specifying the reason the product is being returned. Specific test data, written observations on the failure and the specific corrective action you require are needed.

## 2. SPECIFICATIONS

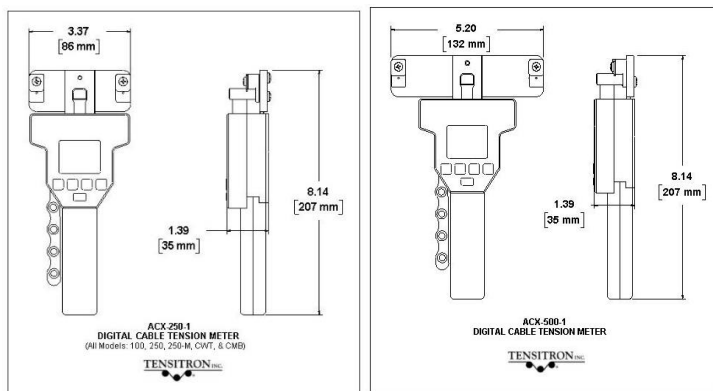

*Figure 1: ACX-1 Dimensions*

### Full Scale Accuracy

- For all models up through 500 lb.: **2%**
- For ACX-1200-1: **3%**
- Accuracy for custom calibrations is material specific

### Power Requirements

- For Instrument Input: 9 VDC...2.2A
- For AC Adapter: 100-240V~50-60Hz 0.48A
- Power Supply operates with input voltages from 100 – 240V and includes several interchangeable adapters allowing use with European, U.S., Australian, English and other plug configurations.
- Battery: Rechargeable NiMH, custom proprietary design

### Battery Life

Approximately 12 hours depending upon backlighting intensity.

### Operating Temperature

- 32° F to 120° F.
- If these values are exceeded, battery charge/discharge rates will decline. However, this could be offset by using the power supply. Charging in direct sunlight or near a heat source will not produce a full charge and may permanently damage battery pack.

### Storage Temperature

- 20° F to 158° F. (Instrument and Charger)

### Ambient Humidity

- 10% to 90% non-condensing

### Dimensions

- All models except 500 and 1200: 3.37" x 8.14" x 1.39"
- ACX-500 and 1200: 5.20" x 8.14" x 1.39" (See Figure 1)

### Weight

- 1.5 lb. (depending upon instrument configuration).

### Environment:

- Indoor or outdoor use, dust-free environment.

### 3. SAFETY

**WARNING:** When using cordless, electronic instruments, always follow basic safety precautions to reduce the risk of fire, electric shock and personal injury

**READ AND SAVE ALL INSTRUCTIONS FOR FUTURE USE.** Before use, ensure all users read and understand this manual, as well as any labels packaged with or attached to the instrument.

- Know your instrument. Read this manual carefully to learn your tension meter's applications and limitations, as well as the potential hazards associated with this type of instrument.
- Avoid dangerous environments. Do not use your instrument in the presence of explosive atmospheres (gaseous fumes, dust or flammable materials). Do not submerge your instrument in liquids.
- Use the right tool or instrument. Do not use this instrument to do a job for which it is not recommended.
- Check for damaged parts. Inspect instrument before use. Check for any binding of moving parts, improper mountings, broken parts and any other condition that may affect operation. Do not use a damaged instrument. Tag damaged instrument "DO NOT USE" until repaired. For repair, contact Cooper Instruments at 800-344-3921.
- Guard against electric shock.
- Maintain instrument carefully. Keep handles dry, clean and free from oil and grease. Do not lubricate. All roller bearings are sealed.
- Do not use instrument if it has received a sharp blow, been dropped or damaged in any way. Do not disassemble. Incorrect reassembly may result in damage to the instrument and risk of electric shock and fire. If instrument is damaged return it to Cooper Instruments for repair.
- Unplug charger when not in use.
- **WARNING:** Only use battery pack assemblies provided with your meter (P/N: ACX-BATT). Other types of batteries might explode, causing personal injury and damage.

## 4. INSTRUMENT OPTIONS

### Standard Instruments

Model	Cable Selection	Resolution (pounds)	Range (pounds)
ACX-100-1	1/16", 3/32", 1/8", 5/32"	0.5	5-100
ACX-100-M-1	2.0mm, 2.5mm, 3.5mm	0.5	5-100
ACX-100-FM-1	1/16", 3/32", 1/8", 5/32", 2.0mm, 2.5mm, 3.5mm	0.5	5-100
ACX-250-1	1/16", 3/32", 1/8", 5/32", 3/16"	0.5	20-250
ACX-250-M-1	2.0mm, 2.5mm, 3.5mm, 4.0mm	0.5	20-250
ACX-250-FM-1	1/16", 3/32", 1/8", 5/32", 3/16", 2.0mm, 2.5mm, 3.5mm, 4.0mm	0.5	20-250
ACX-CWT-1	5, 10, 15, 20 & 25 CWT cables	0.5	20-250
ACX-CMB-1	1/16", 3/32", 1/8", 5/32", 3/16", 5, 10, 15, 20, 25 CWT	0.5	20-250
ACX-500-1	3/32", 1/8", 5/32", 3/16", 1/4"	1	40-500
ACX-500-M-1	2.5, 3.5, 4.0, 4.5mm	1	40-500
ACX-500-FM-1	3/32", 1/8", 5/32", 3/16", 1/4", 2.5, 3.5, 4.0, 4.5mm	1	40-500
ACX-1200-SCB-1	3/16"	5	100-1200

## Add-On Options

*Instruments can be configured with either of these options, but not both:*

- **- A Analog Output option**

Data output at 40 Hz.

0-5 VDC or 4-20 mA with Software-definable ending sequences.

Provided with 10' cable.


- **- E RS-232 Serial Output option**

Select data sampling rate from 1, 2 or 5 Hz.


Provided with 10' cable to Interface with your receiving device.

## Features of all Instruments

- Color graphic display:
- Large and easy to read, with adjustable backlighting.
- Shows Tension, Battery Charge Level, and Cable Size Selected.
- Includes user-definable tension set points.
- Store Function: Store and display up to five separate tension readings plus the minimum/maximum and average value of these stored readings.
- Data Statistics: Monitor your process by viewing count, average, minimum/maximum, and standard deviation values of your logged data.
- Selectable Tension Units: Choose to display tension in Lb, Kg or daN.
- Up to ten calibrations can be programmed into the instrument. (Password-protected to provide due diligence against unauthorized changes.)
- Adjustable LCD refresh rates allow for stable digital readings.
- Automatic shutoff after several minutes of non-use.
- All models are typically available from stock.
- All models are factory calibrated and ready for use.
- All calibration values are traceable to National Standards.
- Calibration certificate is included.
- Continuous operation while connected to power supply.
- Durable, lightweight carrying case with protective foam inserts included. (See Figure 2)
- Cable diameter gage included, to easily and accurately measure cable size. (See Figure 3)

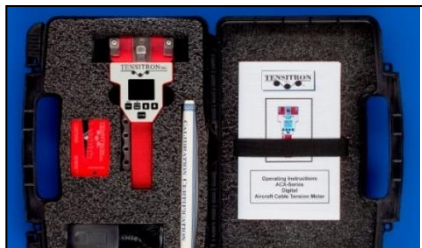

**Figure 2: Carrying Case with Instrument, Calibration Record, charger, adapters and Operating Instructions.**

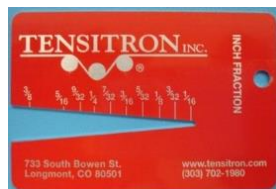

**Figure 3: Cable Diameter Gage**


## 5. BASIC OPERATION


### Charging Instrument Batteries

1. Connect power supply cable to instrument.
2. Plug the power supply into a power source with input voltages between 100 – 240 VAC.
3. A full charge of the battery assembly requires several hours of charging.
4. Battery pack assembly cannot be overcharged.
5. Instrument will remain on while connected to its power supply.
6. Battery charge level is indicated in the upper, right-hand corner of the display.

### Quick Start Instructions


1. Power unit on by pressing ON button. Main display will indicate: Tension, Material, five stored tension readings and their average, and other information. (See Figure 4.)
2. Select a screen:
  - a. Move between screens by using the up (↑) and down (↓) buttons.
  - b. Make or enter a selection by pressing the Enter/Zero button.
  - c. Exit a setting by pressing the Escape (ESC) button.

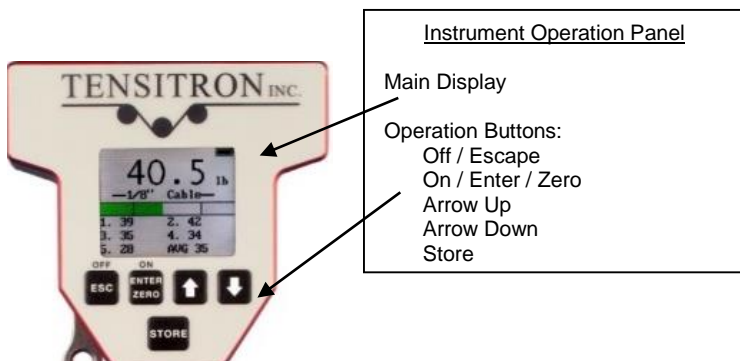

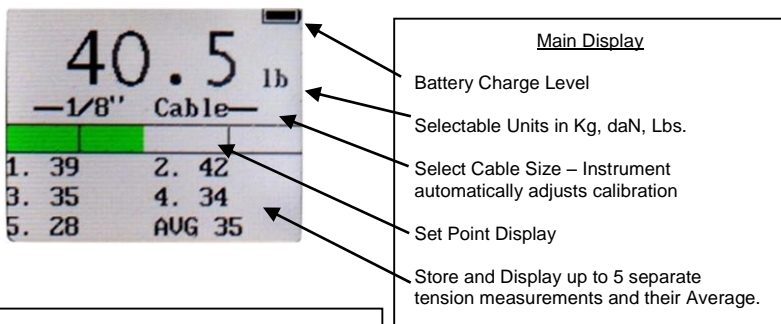

**Figure 4: Instrument Operation Panel and Display**

3. Log Data:
  - a. Press the STORE button to store and display up to five separate tension readings along with the average of these values.
  - b. Clear the data displayed on the Main Screen by pressing and holding the STORE button, or power the instrument off.
  - c. For additional information on logging and viewing data, refer to Sec 6 Display Screens - Data Logging.
4. Read Tension: Variations in materials and cable diameters affect tension readings. It is essential to select the correct material and size before use, or tension values may be incorrect.
5. Select Tension Units:
  - a. Using the up or down arrows, scroll to TENSION UNITS, then press ENTER.
  - b. Next, select from: Kilograms, DecaNewtons, or LBS, and then press ENTER.
6. Select Material:
  - a. Using either the up or down arrows, scroll to SELECT MATERIAL, then press ENTER.
  - b. Next scroll through the cable descriptions until the correct cable size is highlighted, then press ENTER. Your main display will indicate the cable size selected. (See Figure 5)
  - c. If your specific material is not listed, add it to the menu by following the calibration instructions included at the end of these instructions. Or, send a 15' sample of your material/cable and the instrument to Cooper and ask to have it added to the menu.

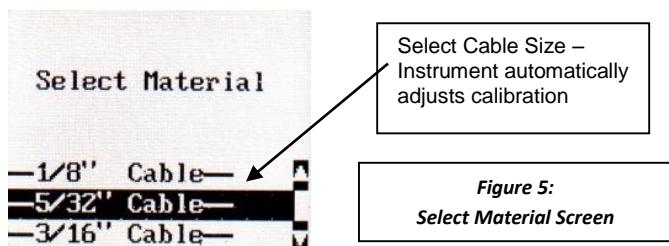

7. Zero Instrument: Hold the instrument in the attitude your reading will be taken before you engage it to the tensioned material/cable. Then, press ZERO.

## Engaging Instrument onto Cable

### WARNING:

DO NOT OVER TORQUE THE ENGAGEMENT LEVER OR YOU WILL DAMAGE THE INSTRUMENT!

DO NOT EXCEED THE MAXIMUM TENSION RANGE OF THE INSTRUMENT OR DAMAGE WILL OCCUR!

- To engage the instrument on the cable, first rotate the engagement lever away from the instrument, raising the outer cable contact guides. Next, position your cable beneath the outer cable contact guides and above the center contact point. (See Figure 6)
- Once the cable is in place, squeeze the engagement lever shut until it locks into position parallel with the instrument handle. **Note: If it takes a lot of force to close the lever, STOP!, something is binding or the cable is too large in diameter. Closing the lever in this situation will damage the instrument.**
- Note the tension reading on the display. (See Figure 7)



Note the routing of the Cable.

Ready the instrument to accept cable by rotating engagement lever away from handle.

**Figure 6: Instrument ready to engage**



Note the routing of the Cable.

Once cable is properly routed, gently squeeze the engagement lever back toward the handle until it locks into the engaged position, parallel to the instrument handle.

**Don't over torque!**

**Figure 7: Instrument engaged onto cable**

## 6. DISPLAY SCREENS

### SETUP Screen

#### ○ LCD Refresh Rate

To either speed up or slow down the instrument's LCD refresh rates:

- Scroll to SETUP and press ENTER.
- Scroll to LCD REFRESH RATE and press ENTER.
- Select your preference: 1, 2 or 5 Hz and press ENTER.

Note: This feature is unrelated to Data Averaging

- **Data Averaging**

Note: This feature is primarily used in processes where the material to be checked is constantly moving, such as coil winding, and textiles, and likely does not apply to use on Aircraft cables.

- **Custom Names**

Custom calibrations, listed as Custom 0 – 9, can be renamed so your material appears as a selection on the Main Display. To rename a Custom Calibration:

- Scroll to SETUP and press ENTER.
- Scroll to CUSTOM NAMES and press ENTER.
- Scroll to the description to rename and press ENTER.
- Input your custom name by using the up and down arrows to select each number, letter, or character, followed each time by ENTER.
- Continue pressing ENTER until all spaces in the description have values, including blank spaces.
- Once your new name has been entered you will automatically be returned to the SETUP screen.

- **Re-Cal Tension: See description at the end of this booklet.**

**ONLY PERFORM THIS IF YOU ARE A QUALIFIED CALIBRATION HOUSE USING NIST-CERTIFIED CALIBRATION WEIGHTS. NOT USED FOR CHECKING ACCURACY. TO CHECK ACCURACY, REFER TO SEC. 7: CHECK ACCURACY.**

- **Audio**

To turn the Beep ON or OFF:

- Scroll to SETUP and press ENTER.
- Scroll to AUDIO and press ENTER.
- Select ON or OFF and press ENTER.

- **Backlight**

To adjust the visual intensity of the LCD screen.


- Scroll to SETUP and press ENTER.
- Scroll to BACKLIGHT and press ENTER
- Select Low, Medium or Full intensity and press ENTER.

- **Set-Point Menu**

This feature displays tension as a colored bar on the main display. The colored bar advances as tension increases, and retracts as tension decreases. You can define a safe operating tension range. For tension measurements within this range, the bar is green. Below the range, the bar is amber. Above the range, the bar is red.

To adjust the Set Point Menu:

- Scroll to SETUP and press ENTER.
- Scroll to SETPOINT MENU and press ENTER.
- Follow and enter the prompts to turn this feature on or off, or to edit your high and low values. (See Figure 8)

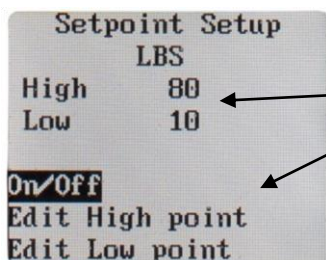

#### Set Point Setup Screen

See High and Low threshold values Settings:

On / Off

Edit High Point Threshold

Edit High Point Threshold

*Figure 8: Setpoint Setup*

#### ○ Version

Press this button to determine what Model the instrument is set at in the firmware as well as to see what level of firmware is downloaded to the Instrument.

### **DATA LOGGING Screen**

Each time the instrument's STORE button is pressed, a log of that cable tension will be stored into memory for later review.

#### ○ View Data Stats

This feature allows the operator to view the basic statistics of the logged data (Count, Average, Minimum/Maximum, and Standard Deviation).

#### ○ View Data Log

When data is logged to the instrument memory, that data and the statistics of that data log (Count, Average, Minimum/Maximum, and Standard Deviation) can be seen under the Data Logging / View Data Stats screen. To view this logged data:

- Scroll to DATA LOGGING and press ENTER.
- Scroll to VIEW DATA LOG and press ENTER.

#### ○ Clear Single Point Log

To clear stored data, scroll to CLEAR SINGLE PT LOG, press ENTER, and follow the prompts.

### **TENSION UNITS Screen**

To change the unit of measure in which tension readings are logged:

- Scroll to Tension Units and press ENTER.
- Use the Up and Down arrows to select Kilograms, DecaNewtons or Pounds and press ENTER.

### **SELECT MATERIAL Screen**

Press ENTER while this display is shown to show the available options for the material types. Use the up or down arrow to scroll to the option you want and press ENTER to select it.

## 7. ADVANCED OPERATION

### General Calibration Precautions

1. To verify the accuracy of your instrument, check the tension on a sample length of cable by suspending known weights from the opposite end.
2. When performing this test, use a micrometer to measure your cable diameter and ensure it is dimensionally within tolerance, +/- .003" of size, and not out of round.

### CABLE DIMENSIONS

#### Standard Aircraft Cables CWT Aircraft Cables

1/16" = .0625"	5-CWT = .076"
3/32" = .0938"	10-CWT = .106"
1/8" = .1250"	15-CWT = .141"
5/32" = .1562"	20-CWT = .155"
3/16" = .1875"	25-CWT = .170"
7/32" = .2188	
1/4" = .2500	

3. Only use free-hanging weights which are traceable to National Standards on correctly-sized cables. (See Figure 9.)
4. Never use any tensioning device that attempts to convert rotational torque values into tension loads, as these types of systems are highly inaccurate. Also, any load cell system must be routinely checked for accuracy using traceable weights as these types of systems are also highly inaccurate and generally do not meet the minimum repeatable accuracy standards required by ISO-17025.
5. NEVER SIMULATE TENSION LOADS ON THESE INSTRUMENTS BY USING A CALIBRATION BAR!

### Check Accuracy

1. Confirm that the size cable you're working with is the same size selected in your ACX's display.
2. Before engaging the ACX instrument onto the cable, zero the instrument by holding it in the same attitude you'll be taking the readings and press the "Enter" or "Zero" button. This will eliminate any small tare effects.

Take readings along the cable. FOR BEST RESULTS ALWAYS TAKE SEVERAL READINGS OF THE CABLE TENSION BY DISENGAGING AND THEN RE-ENGAGING THE INSTRUMENT ONTO THE CABLE.

3. Verify the tension value. For example, if your suspended weight is 40.0 lb. your instrument should also indicate 40.0 lb. +/- 5.0 lb. once properly engaged to the cable. This procedure confirms the instrument's accuracy and it is now ready for use.

**Note: Accuracy Specification:** For an instrument with a full-scale range of 100 lbs this translates into +/- 2 Lbs. For 250 lbs this translates into +/-

5.0 lbs, and for an instrument with a full-scale range of 500 lbs, accuracy is +/- 10.0 Lbs. Full-Scale accuracy for the Model: ACX-1200-1 is +/- 3% (+/- 36 lbs).

If you have additional questions, please contact Cooper Instruments at 800-344-3921 for help.

## Calibrate Instrument

**\*IMPORTANT: THIS FEATURE SHOULD ONLY BE USED BY A CALIBRATION FACILITY USING CERTIFIED AND TRACEABLE DEAD WEIGHTS. DO NOT USE THIS FEATURE FOR A SIMPLE ACCURACY CHECK.**

***If you want to verify or check the accuracy of a cable go to: “Check Accuracy” in Section 7: Advanced Operation.***

***When calibrating these instruments tension values must be entered in Lbs. Note: If your dead weight standards are in Kilograms, convert their values into Lbs: 1 KG = 2.2046 Lbs***



***Figure 9: Free Hanging Weight  
simulating cable tension.***

1. Scroll to **SETUP** and press ENTER. Next, scroll to **RE-CAL TENSION** and press ENTER. The screen will now display: **SETUP, RE-CALIBRATE TENSION, ENTER PASSWORD, CAL DATA WILL BE LOST!**
2. **Password.** To proceed with calibration you must enter the following sequence: Press **ENTER**, then press the **UP** arrow, and then press **ENTER** button. These three inputs: **ENTER, UP, ENTER** are the password. It cannot be changed.
3. The display now indicates: **SETUP RE-CALIBRATE TENSION** with a list of the calibration names and custom names programmed into the instrument. Scroll to the description you wish to recalibrate, highlight it and then press **ENTER**.

4. The next screen will indicate: **CALIBRATE TENSION, NUMBER OF POINTS.** Using the up and down arrows select the number of calibration points to which you will be tensioning the cable. The minimum is 5 points. Zero is a calibration point already set, so you will need to define a minimum of 4 increasing tension values such as: 50, 100, 150 and 200. If desired you can define more than 5 weight points, with a maximum of 10 points total. If 10 calibration points were selected the entries could look something like this: 10, 20, 30, 40, 50, 60, 70, 80, 90.

5. **ENTER WEIGHT.** After selecting the number of calibration points, you need to define these weight values. Using the up or down arrows select your first tension, or weight calibration point and press **ENTER**. *Do not use 0 (zero) as this value is already programmed into the instrument.* Next, use the up or down arrows to select your **weight 2** value, making sure the value entered is greater than the entry in **weight 1**. Next, select increasing weight values for the additional weight points, without exceeding the maximum tension range of the instrument.

6. **CALIBRATE TENSION.** Next you will calibrate the instrument using the weight values you previously selected. To properly simulate these tensions, suspend a single length of your cable from above and suspend known weights onto the cable in the values you've previously selected, when prompted. (See Figure 9.)

- a. **CALIBRATE TENSION, NUMBER OF POINTS \_\_, ZERO UNIT.** Without any cable engaged to the instrument, hold it in the attitude you will be taking the reading in and press ENTER to calibrate zero weight. Next the display will prompt you to suspend the weight value you previously selected in step 5. If, for example you selected 50 lb. for your first weight value the instrument will indicate: PLACE WEIGHT 50.
- b. Suspend the exact weight value from your cable that you've previously selected (In this example it would be 50 lb.)
- c. Next, engage the instrument to your tensioned cable, then press ENTER once the reading has stabilized.
- d. Repeat steps b. and c. for the remaining weight points by suspending additional weights onto your cable in the values previously selected and entering these readings.
- e. Once the last weight value is entered, the instrument will return to the SETUP menu. Press the ESCAPE button to return to the main display.
- f. The main display will now indicate the cable/material description you just finished calibrating. If the material name on the display is not the material you just recalibrated, you have re-programmed the incorrect description. If this happens, you will need to recalibrate both the material indicated on the display along with the material you thought you were calibrating.
- g. After completing a calibration always recheck the values. Refer to "Check Accuracy" in Section 7.